



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

D350-636-015
Job Sheet 182676



Part No: D350-636-015

Job Qty: 1 ea

Part Name: Skidtube LH, Run-on Landing Wearplates, DART(Apical) Cylind./Aerazur Float Comp.



Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 8/29/18

Job Tracking No:

Due Date: 9/28/18

Created By: Marie Lajeunesse

Type: Stock

Description:

Note: DWG REV B SHEETS 1,2,4,8 IPP rev:A 10.09.28 new issue DD verf:EC IPP Rev:B 11.04.14 ecn11-553 DD verf:EC IPP Rev:C 11.10.18 as per NCR 11-906 DD verf:EC IPP Rev:D 112.04.16 AS PER ECN 12-542 DD verf:EC IPP REV:E 13.08.28 PER ECN13-594 DD VERF:JLM

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea		9/28/18	0.00	0.00	Start Up Skid tubes-1		J.S.
110	Skid tubes	1 pcs		9/28/18	0.00	5.25	Skid tubes-1		J.S. DAS 8/31
120	QC	1 pcs		9/28/18	0.00	0.00	QC10		38 DAS 9-89
130	QC	1 pcs		9/28/18	0.00	0.00	QC5		38 DAS 9-89
140	HandFinish	1 pcs		9/28/18	0.00	0.99	HandFinish1		D.R. 18/09/26
150	QC	1 pcs		9/28/18	0.00	0.00	QC7-2		M.D. 18/09/26
160	Skid tubes	1 pcs		9/28/18	0.00	5.25	Skid tubes-1		M.D. DAS 8/31 J.S. 18/09/26
170	QC	1 pcs		9/28/18	0.00	0.00	QC10		38 DAS 9-89
180	QC	1 pcs		9/28/18	0.00	0.00	QC5		38 DAS 9-89
190	HandFinish	1 pcs		9/28/18	0.00	0.99	HandFinish2		D.R. 18/10/17
200	SprayPaint	1 pcs		9/28/18	0.00	0.91	Spray Paint		Rec'd 18/10/17 OCT 3 0 2018
210	QC	1 pcs		9/28/18	0.00	0.00	QC14		38 DAS 18-10-2018
230	HandFinish	1 pcs		9/28/18	0.00	0.99	HandFinish4		OCT 3 1 2018 68
240	QC	1 pcs		9/28/18	0.00	0.00	QC5		68 9-89
250	Packaging	1 pcs		9/28/18	0.00	0.00	Packaging1-3		NOV 0 8 2018
260	QC	1 pcs		9/28/18	0.00	0.00	QC4		DAS 21
270	Packaging	1 pcs		9/28/18	0.00	0.00	Packaging3-1		NOV 0 8 2018
275	DC	1 pcs		9/28/18	0.00	0.00	DC		NOV 0 8 2018
280	QC21-FG	1 Ea		9/28/18	0.00	0.00	QC21		NOV 0 8 2018

Part Op 110 - 1- Pick D2600-3 Bent 2- Deburr FWD and AFT ends, remove bending marks. Scribe batch# inside AFT end per dwg
Descriptions: D4168-1 3- Drill pilot holes for blade fitting bolt holes using DT8983. Start with 3/16", then open to 0.500" using center drill then ream holes using 0.500" reamer. PIN first side. Repeat process on second side. ***ENSURE PROPER POSITIONING FWD BEND MUST BE FACING UP WHEN DRILLING FIRST SIDE*** Drill pilot holes as per Dwg D4168 sheet 4 (D4168-1 details). Drill using drill Jig DT8150 & DT8863A for first side only DT8863B for second side (detail B) 4- Locate DT8330 off of blade fitting bolt holes and drill pilot holes for blade fitting, section H-H. Open to 0.500" using hole saw. VERIFY AND RECORD FWD BEND ANGLE, 5- Drill tow ring hole using DT9616 detail "A" 6- Drill most FWD wearplate hole using DT9678 locating off of 66.54" hole. 7- Open up holes of Detail A to 0.297" (total of 2 holes per side) and .201" (total of 1 hole per side) 8- Weld D2744 Cap as per Dwg D4168 and QSI 004. Fill grooves in bend left from bending as per QSI 004 A/R Aluminum Rod batch 38831 9- Grind welds flush as per Dwg D4168
160 - 1-Open up holes using hole saw of Detail C and ground handling section AL-AL to 0.625" (total of 8 holes per side) as per dwg D4168. 2-Open up holes using hole saw of Detail B to 0.750" (total of 4 holes per side) as per dwg D4168. 3- Open float hole to 0.500" using uni-bit (4 per side) section AJ-AJ Open wearplate holes to size as per dwg (4 holes per sides) , section CG-CG 4-Chamfer holes of Detail B, C, ground handling section AL-AL and float holes section AJ-AJ per

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____ Date : _____	DISPOSITION	AGAINST DEPARTMENT/PROCESS			
		☐ Tube ☐ Fab ☐ Milling ☐ Site	☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier	☐ Engineering ☐ Quality ☐ Other	
		MRB (QSI042) Approval			
		Completed By			
		Lead hand / Supervisor Approval Verification			
		QC / QA Coordinator Approval			

Root Cause				FAULT CATEGORY			
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER :			
Misidentified	☐	Past Due	☐				

dwg D4168 (welding instructions on sheet 8) 5-Deburr and blow out all chips from inside of tube 6- Prepare tube for welding, remove alodine as required. 7-Bond web D2739 in place as per QSI 015, let cure for 12hrs. A/R Sikaflex-291 batch: m138443 exp. date: 19-03-00 ***ATTN: USE I-BEAM LOCATION AID (BLADE FITTING)*** 8- Weld spacers D3490-1, D3490-3 and D2743 as per dwg D4168 and D4170-1 & QSI004 (welding instructions on sheet 8) A/R Aluminum Rod batch: 138673 9- At section AJ-AJ drill out x-bolt spacer to 0.404" 10-Grind welds flush as per Dwg D4168 11-Spot face ground handling holes section (total of 4 places per side) as per dwg D4168, section AL-AL 12- C'bore section CG-CG. ADJUST TOOLING AS REQUIRED. VERF BY: _____ 13- Deburr holes, ensure tube is free of all scratches before sending to paint. *****
180 - *VERIFY C'BOARD IS GOOD*****
190 - Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.
200 - 1- PRIME AS PER DWG AND QSI 005 4.2.1.3.3 PRIMER PRC DESOTO 515X349 BATCH: _____
2- PAINT WHITE AS PER DWG AND QSI 005 4.2 PAINT BATCH: _____
210 - Inspect for foreign object per QSI 024
230 - 1- Install inserts as per Dwg D4168 2-Inspect for Foreign Objects 3-Install blade fitting D3488-041, wearshoes and ground handling hardware as per dwg D4168 SIKAFLEX 241 BATCH: M138443 EXP DATE: 19-03
4-assemble o'ring to plug as per dwg D3492 and apply o'ring lube A/R 55-o'ring lube batch: _____ 5-Coat all exposed fasteners with "LPS Procyon" batch: M138443
250 - If making a D350-636-215 pick kit will only requires: 1 X AN3C37A 1 X AN3C34A 1 X AN3C42A 2 X D3493-1
260 - ***ensure antiseize is on AN8C21A bolts*******
270 - Identify and pack for shipping as per PPPD350-636-015 Location : FG071
275 - record fwd angle: 89.9° Photocopy blue file and type labels per PPP D350-636-015 CHG 005

must stay at CHG005
DAS 9-89

DAS 21-9-89

See attachment

DAS 9-89

006169

Part / Item	Component Name	Quantity	Operation	Container
D2600-3-BENT-LH	Extrusion Bent LH	1 Ea (1 ea)	90-Start up Operation	5082073
D2744	Cap	1 Ea (1 ea)	90-Start up Operation	5060499
D2739	350 I-Beam	1 Ea (1 ea)	160-Skidtubes	5081787
D2743	Crossbolt Spacer	8 Ea (8 ea)	160-Skidtubes	5090612
D3490-1	Cross Bolt Spacer	4 Ea (4 ea)	160-Skidtubes	5088748
D3490-3	Cross Bolt Spacer	4 Ea (4 ea)	160-Skidtubes	5107862
ALS4-1032-225	Rivnut	4 Ea (4 ea)	230-HandFinish	5019233
AN3C34A	Bolt	1 Ea (1 ea)	230-HandFinish	5058138
AN3C36A	Bolt	4 Ea (4 ea)	230-HandFinish	M136658-1
AN3C6A	Bolt	4 Ea (4 ea)	230-HandFinish	5063954
AN6C44A	Bolt	4 Ea (4 ea)	230-HandFinish	5019457
AN8C35A	Bolt	1 Ea (1 ea)	230-HandFinish	5006333
D2745 5091810	Bushing	8 Ea (8 ea)	230-HandFinish	5103997
D3488-041	Blade Fitting LH	1 Ea (1 ea)	230-HandFinish	5092787
D3492-1	Plug	8 Ea (8 ea)	230-HandFinish	5107239
D3492-3	Plug	8 Ea (8 ea)	230-HandFinish	5107030
D3631-1	Washer	8 Ea (8 ea)	230-HandFinish	5058407
D3873-1	Bushing	7 Ea (7 ea)	230-HandFinish	5117551
D4154-041	Wearplate Assembly	1 Ea (1 ea)	230-HandFinish	5103291
D4170-1	Bushing	4 Ea (4 ea)	230-HandFinish	5019233
D4171-1	Bushing	1 Ea (1 ea)	230-HandFinish	5061056
MS21043-3	Nut	5 Ea (5 ea)	230-HandFinish	5083543
MS21043-6	Nut	4 Ea (4 ea)	230-HandFinish	5058146
MS21083C8	Nut	1 Ea (1 ea)	230-HandFinish	5090633
NAS1149C0332R	Washer	4 Ea (4 ea)	230-HandFinish	5089465
NAS1149C0363R	Washer	9 Ea (9 ea)	230-HandFinish	5017102
NAS1149C0832R	Washer	1 Ea (1 ea)	230-HandFinish	5076017-2
NAS1515H3L	Washer	4 Ea (4 ea)	230-HandFinish	5083559
NAS1611-010	O-Ring	8 Ea (8 ea)	230-HandFinish	5106792
NAS1611-013	O-Ring	8 Ea (8 ea)	230-HandFinish	5057659
AN3C37A	Bolt	1 Ea (1 ea)	250-Packaging	5064011
AN3C42A	Bolt	1 Ea (1 ea)	250-Packaging	5041523
AN8C21A	Bolt	2 Ea (2 ea)	250-Packaging	5099514
D2741	Replacement Blade	1 Ea (1 ea)	250-Packaging	5082286
D3493-1	Washer	2 Ea (2 ea)	250-Packaging	5084552 51258131
MS21083C8	Nut	2 Ea (2 ea)	250-Packaging	5050046
NAS1149D0863J	Washer	2 Ea (2 ea)	250-Packaging	5089248

006169

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
-----------	----------------	----------	-----------	-----------

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval				
Description Work Order Deviation				Disposition				Completed By			
Root Cause				FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐		No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	
OTHER :											

90-Start up Operation	D2600-3-BENT-LH	1	8	0
	D2744	1	43	0
160-Skidtubes	D2739	1	18	0
	D2743	8	55	0
	D3490-1	4	91	0
	D3490-3	4	14	0
	ALS4-1032-225	4	2,304	0
230-HandFinish	AN3C34A	1	24	0
	AN3C36A	4	517	0
	AN3C6A	4	272	0
	AN6C44A	4	174	0
	AN8C35A	1	54	0
	D2745	8	163	0
	D3488-041	1	10	0
	D3492-1	8	88	0
	D3492-3	8	133	0
	D3631-1	8	587	0
	D3873-1	7	38	0
	D4154-041	1	5	0
	D4170-1	4	18	0
	D4171-1	1	15	0
	MS21043-3	5	1,055	0
	MS21043-6	4	222	0
	MS21083C8	1	211	0
	NAS1149C0332R	4	6,066	0
	NAS1149C0363R	9	193	0
	NAS1149C0832R	1	411	0
	NAS1515H3L	4	527	0
	NAS1611-010	8	213	0
	NAS1611-013	8	170	0
250-Packaging	AN3C37A	1	63	0
	AN3C42A	1	26	0
	AN8C21A	2	106	0
	D2741	1	85	0
	D3493-1	2	41	0
	MS21083C8	2	211	0
	NAS1149D0863J	2	131	0

Part Specifications

Specifications could not be found.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :							
Misidentified ☐	Past Due ☐								

QTY -041	QTY -042	QTY -043	QTY -044	PART NUMBER	DESCRIPTION
X				D4168-041	350 SKIDTUBE ASSEMBLY, LH
	X			D4168-042	350 SKIDTUBE ASSEMBLY, RH
		X		D4168-043	350 SKIDTUBE ASSEMBLY, LH
			X	D4168-044	350 SKIDTUBE ASSEMBLY, RH
1	1	1	1	D2739	WEB
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
8	8	8	8	D3631-1	WASHER
7	7	7	7	D3873-1	BUSHING
1	1	1	1	D4154-041	WEARPLATE ASSEMBLY
1				D4168-1	SKIDTUBE WELDMENT, LH
	1			D4168-2	SKIDTUBE WELDMENT, RH
		1		D4168-3	SKIDTUBE WELDMENT, LH
			1	D4168-4	SKIDTUBE WELDMENT, RH
4	4	4	4	D4170-1	SPACER
1	1	1	1	D4171-1	BUSHING
4	4	4	4	ALS4-1032-225	INSERT
4	4	4	4	AN3C6A	BOLT
1	1	1	1	AN3C34A	BOLT
4	4	4	4	AN3C36A	BOLT
4	4	4	4	AN6C44A	BOLT
1	1	1	1	AN8C35A	BOLT
9	9	9	9	AN960C10	WASHER (OR NAS1149CO363R)
4	4	4	4	AN960C10L	WASHER (OR NAS1149CO332R)
1	1	1	1	AN960C816L	WASHER (OR NAS1149CO832R)
5	5	5	5	MS21043-3	NUT
4	4	4	4	MS21043-6	NUT
1	1	1	1	MS21083C8	NUT
4	4	4	4	NAS1515H3L	WASHER

GENERAL NOTES:

- 1) MATERIAL: MAKE D4168-1/-2/-3/-4 FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.
STANDARD: PRIME (REF. 4.2.1.3.3) AND PAINT WHITE PER DART QSI 005 4.2
OPTIONAL: POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: D4168-041/-042/-043/-044 = 32.3 LBS
- 8) WELD PER DART QSI 004
- 9) FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 KSI
MINIMUM ULTIMATE TENSILE STRENGTH = 38 KSI
- 10) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF
FINISH WITH MEK DEGREASER.
- 11) SPACER AND PLUG INSTALLED SAME AS SECTION AJ-AJ EXCEPT HORIZONTAL
- 12) SPACER AND PLUG INSTALLED SAME AS SECTION AP-AP EXCEPT HORIZONTAL


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT

WITHOUT NOTICE
WORK ORDER
NO. 182676 MJS
1808-30


RELEASED
2013-08-13
JWP

B	ADD VIEW TO CONTROL FWD BEND ORIENTATION (ZN D-1-4/-5/-6/-7); UPDATED FINISH OPTIONS. REASON: PAR13-276 AND NCR13-2757	MB	13.07.11
A	NEW ISSUE	SC	10.08.09
REV.	DESCRIPTION	BY	DATE
DESIGN	SC		
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	13.07.11		

DART AEROSPACE USA, INC. KENT, WA	
DRAWING NO. D4168	REV. B SHEET 1 OF 11
TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS
COPYRIGHT © 2010 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

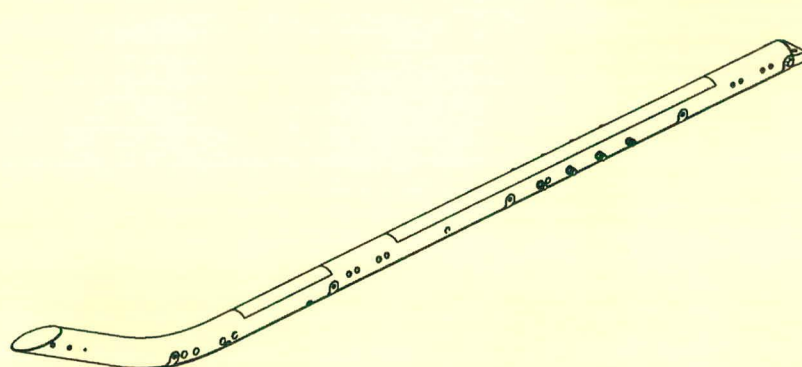


D4168-041 350 SKIDTUBE ASSEMBLY, LH

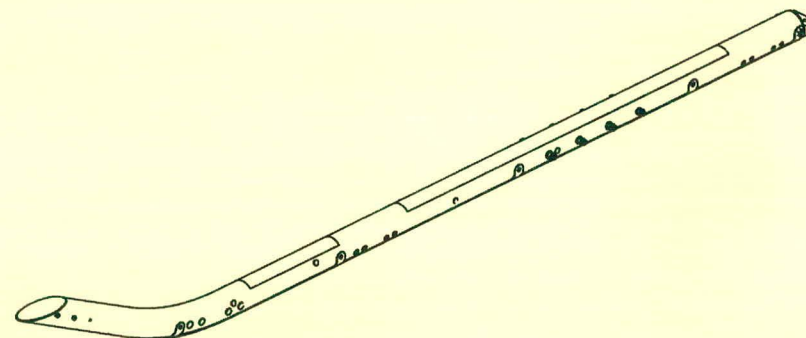


D4168-042 350 SKIDTUBE ASSEMBLY, RH

RELEASED
2013-08-13

DESIGN	SC	DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO.	REV. B
MFG. APPR.		D4168	SHEET 2 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	13.07.11	COPYRIGHT © 2010 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

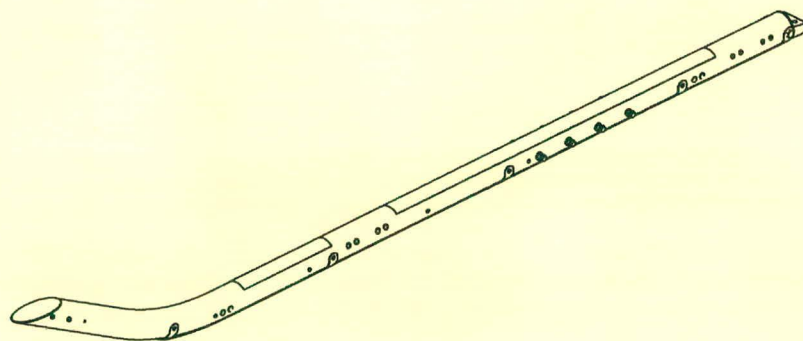



D4168-043 350 SKIDTUBE ASSEMBLY, LH

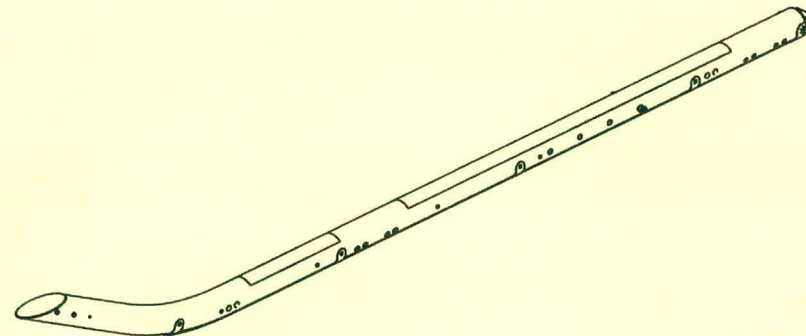


D4168-044 350 SKIDTUBE ASSEMBLY, RH

RELEASED
2013-08-13
MMD


DESIGN		DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	REV. B
CHECKED		DRAWING NO. D4168	SHEET 3 OF 11
MFG. APPR.		TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS
APPROVED		COPYRIGHT © 2010 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	
DE APPR.	DATE 13.07.11		

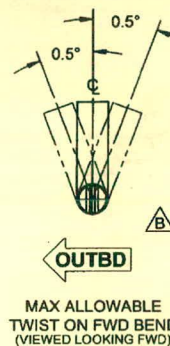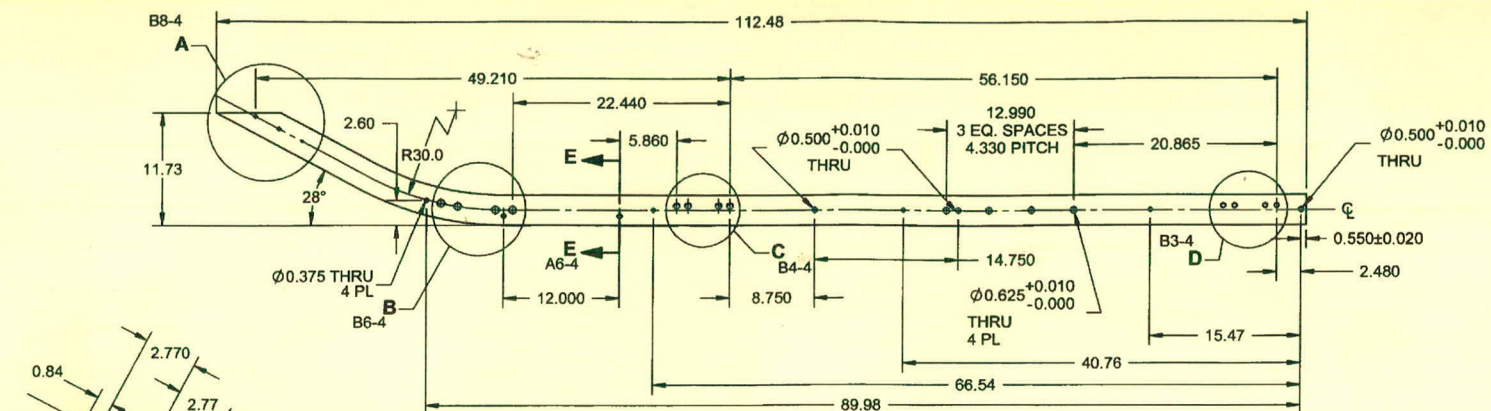


D4168-1 LH SKIDTUBE

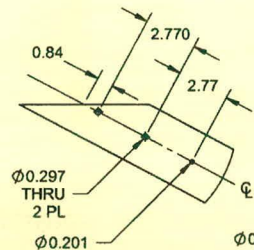


DETAIL A
SCALE 2X

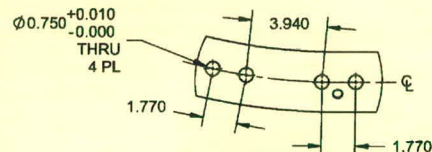


DETAIL B
SCALE 2X

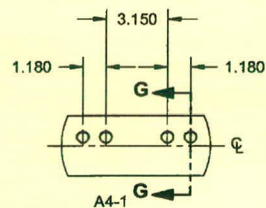


DETAIL C
SCALE 2X

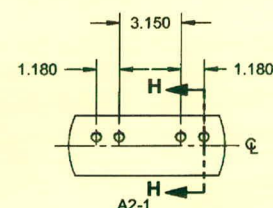


DETAIL D
SCALE 2X

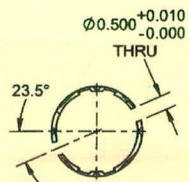

SECTION E-E
SCALE 3X, 2 PL

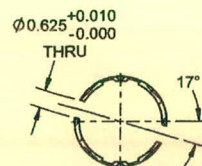

SECTION G-G
SCALE 3X, 4 PL

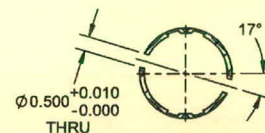

SECTION H-H
SCALE 3X, 4 PL

DESIGN
DRAWN
CHECKED
MFG. APPR.
APPROVED
DE APPR.
DATE 13.07.11


DART AEROSPACE USA, INC.
KENT, WA

DRAWING NO.
D4168
TITLE
350 SKIDTUBE ASSEMBLY



REV. A
SHEET 4 OF 11
SCALE
NTS

COPYRIGHT © 2010 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


RELEASED
2013-08-13

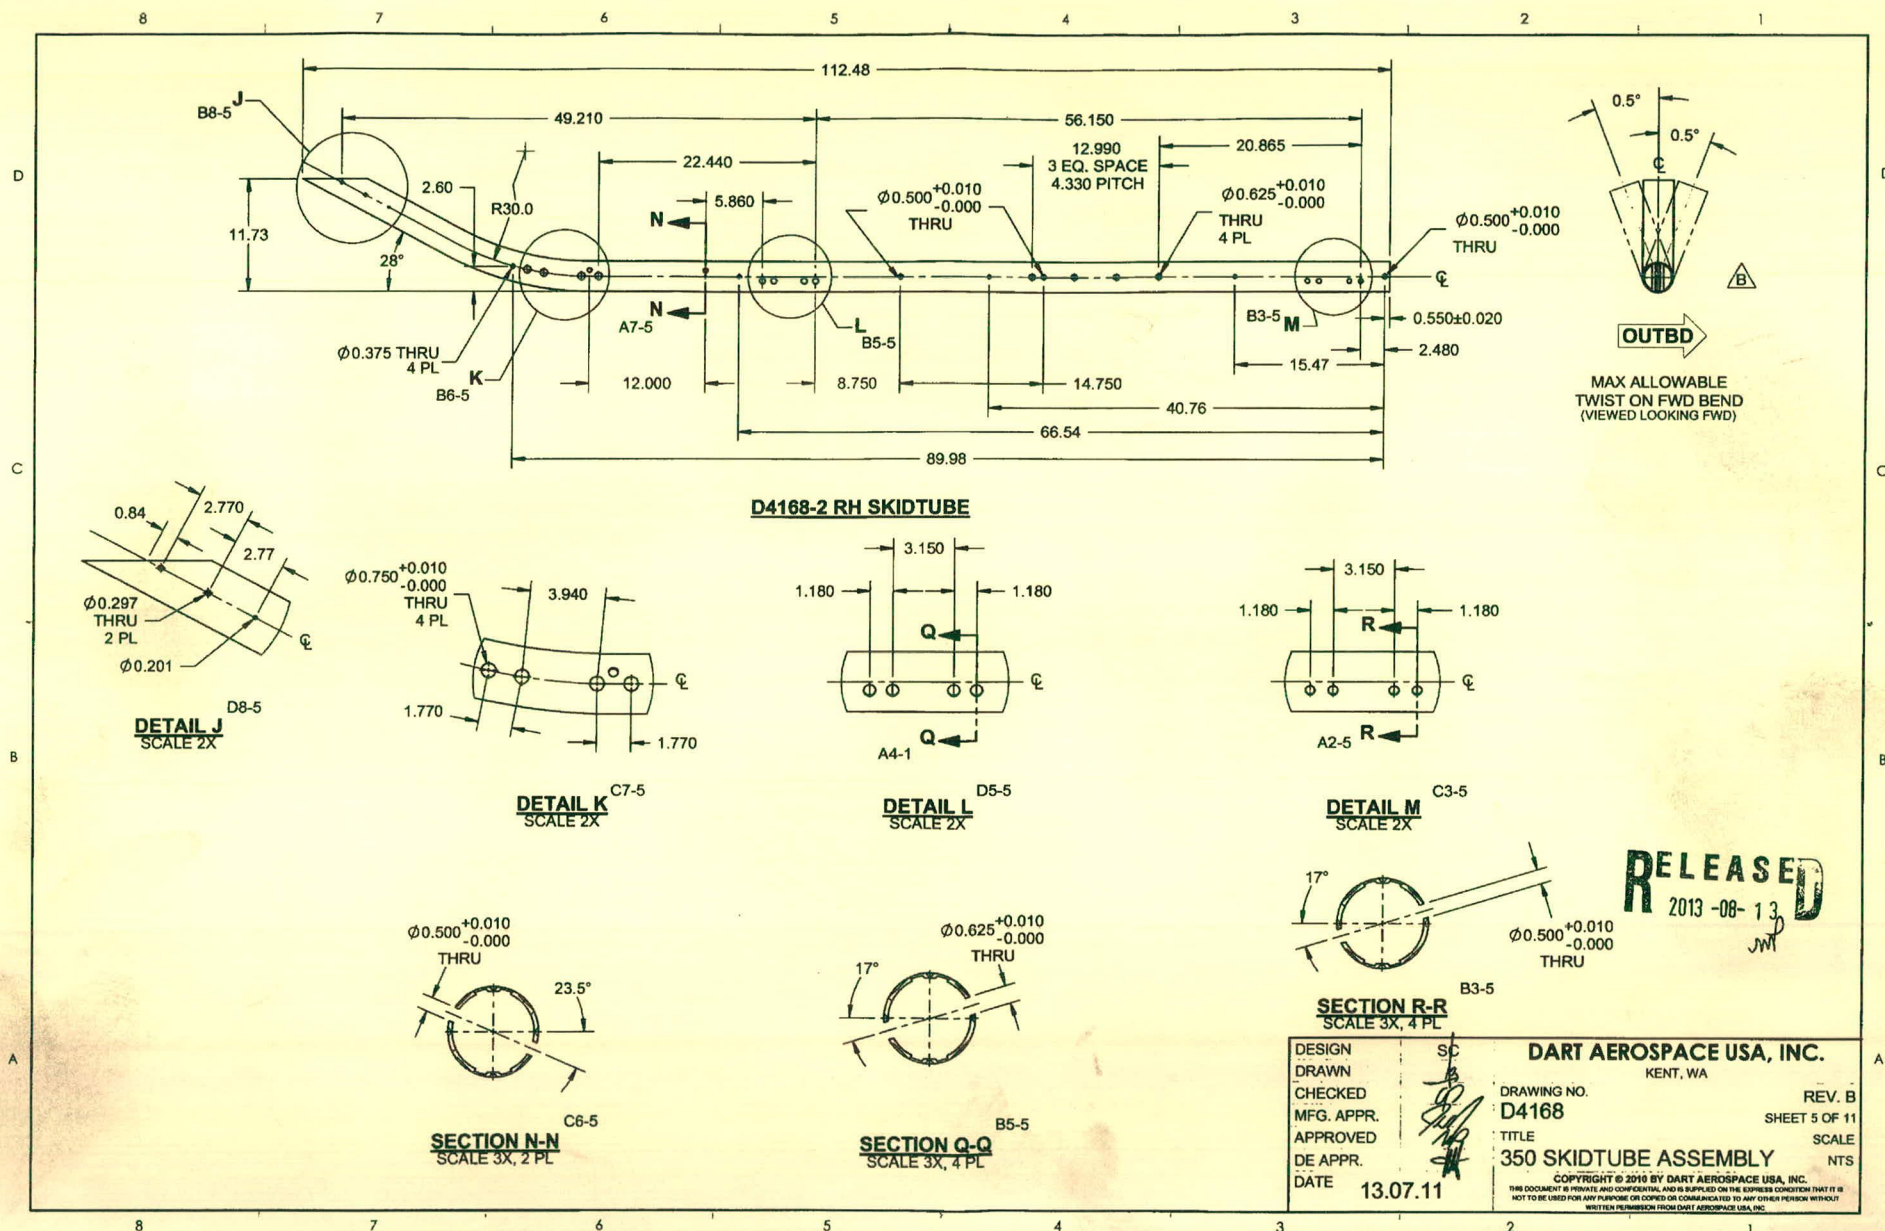


8 7 6 5 4 3 2 1

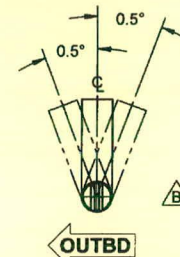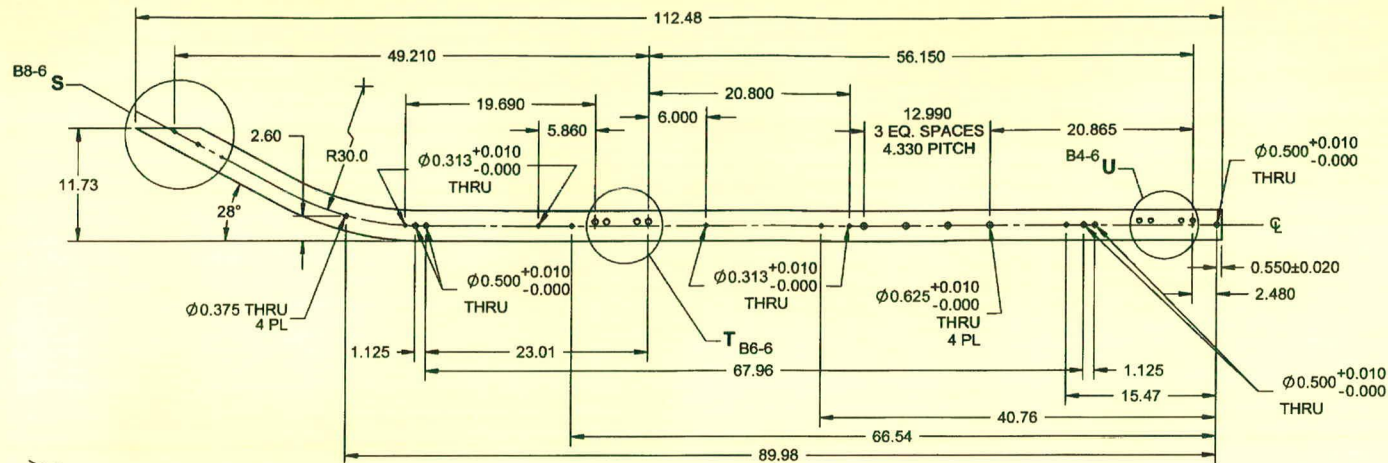


MAX ALLOWABLE
TWIST ON FWD BEND
(VIEWED LOOKING FWD)

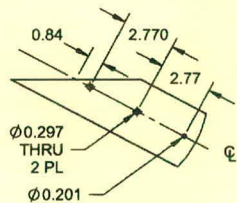


D8-6
DETAIL S
SCALE 2X

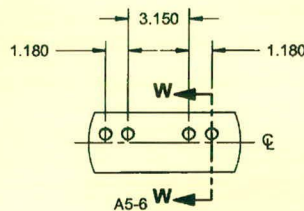


C5-6
DETAIL T
SCALE 2X

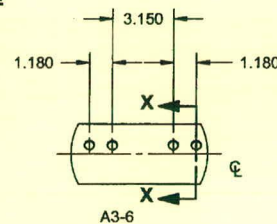

D3-6
DETAIL U
SCALE 2X

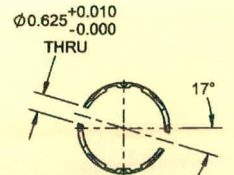

B6-6
SECTION W-W
SCALE 3X, 4 PL

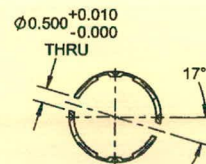

B4-6
SECTION X-X
SCALE 3X, 4 PL

RELEASED
2013-08-13

DESIGN
DRAWN
CHECKED
MFG. APPR.
APPROVED
DE APPR.
DATE 13.07.11



DART AEROSPACE USA, INC.
KENT, WA

DRAWING NO.
D4168
TITLE
350 SKIDTUBE ASSEMBLY
REV. B
SHEET 8 OF 11
SCALE
NTS

COPYRIGHT © 2010 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


8 7 6 5 4 3 2 1

8 7 6 5 4 3 2 1

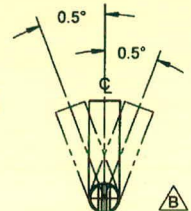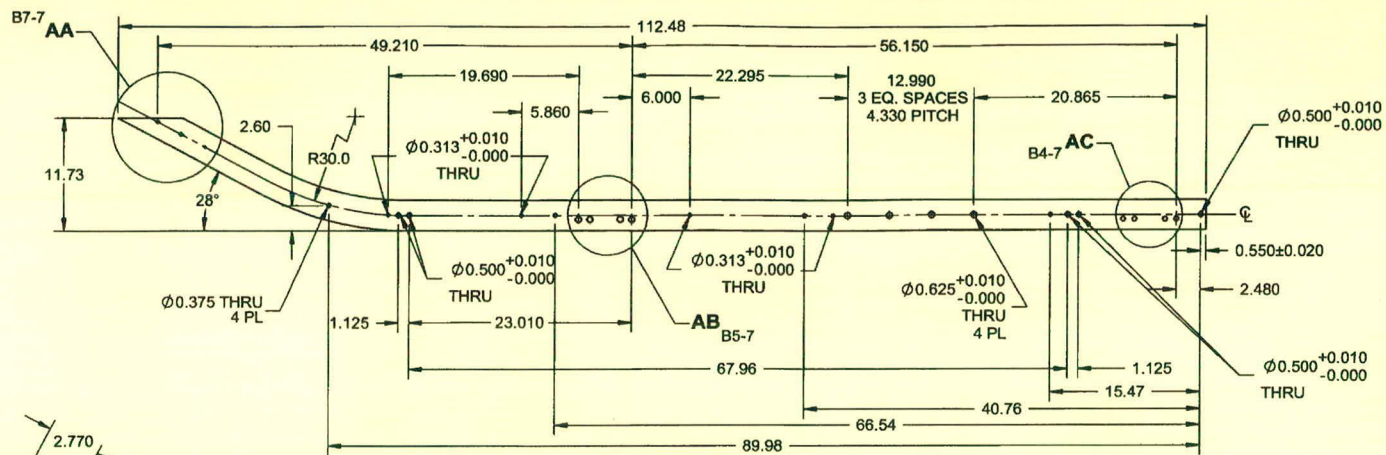


MAX ALLOWABLE TWIST ON FWD BEND (VIEWED LOOKING FWD)


OUTBD

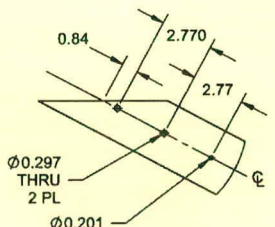


DETAIL AA
SCALE 2X

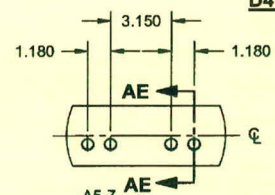


DETAIL AB
SCALE 2X

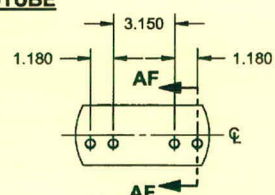

DETAIL AC
SCALE 2X

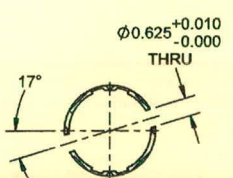

SECTION AE-AE
SCALE 3X, 4 PL

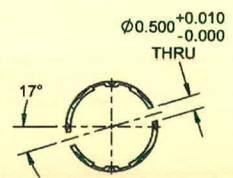


SECTION AF-AF
SCALE 3X, 4 PL

RELEASED
2013-08-13


DESIGN		DART AEROSPACE USA, INC.	
DRAWN		KENT, WA	
CHECKED		DRAWING NO.	REV. B
MFG. APPR.		D4168	SHEET 7 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	
DATE	13.07.11	NTS	


COPYRIGHT © 2010 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

8 7 6 5 4 3 2 1

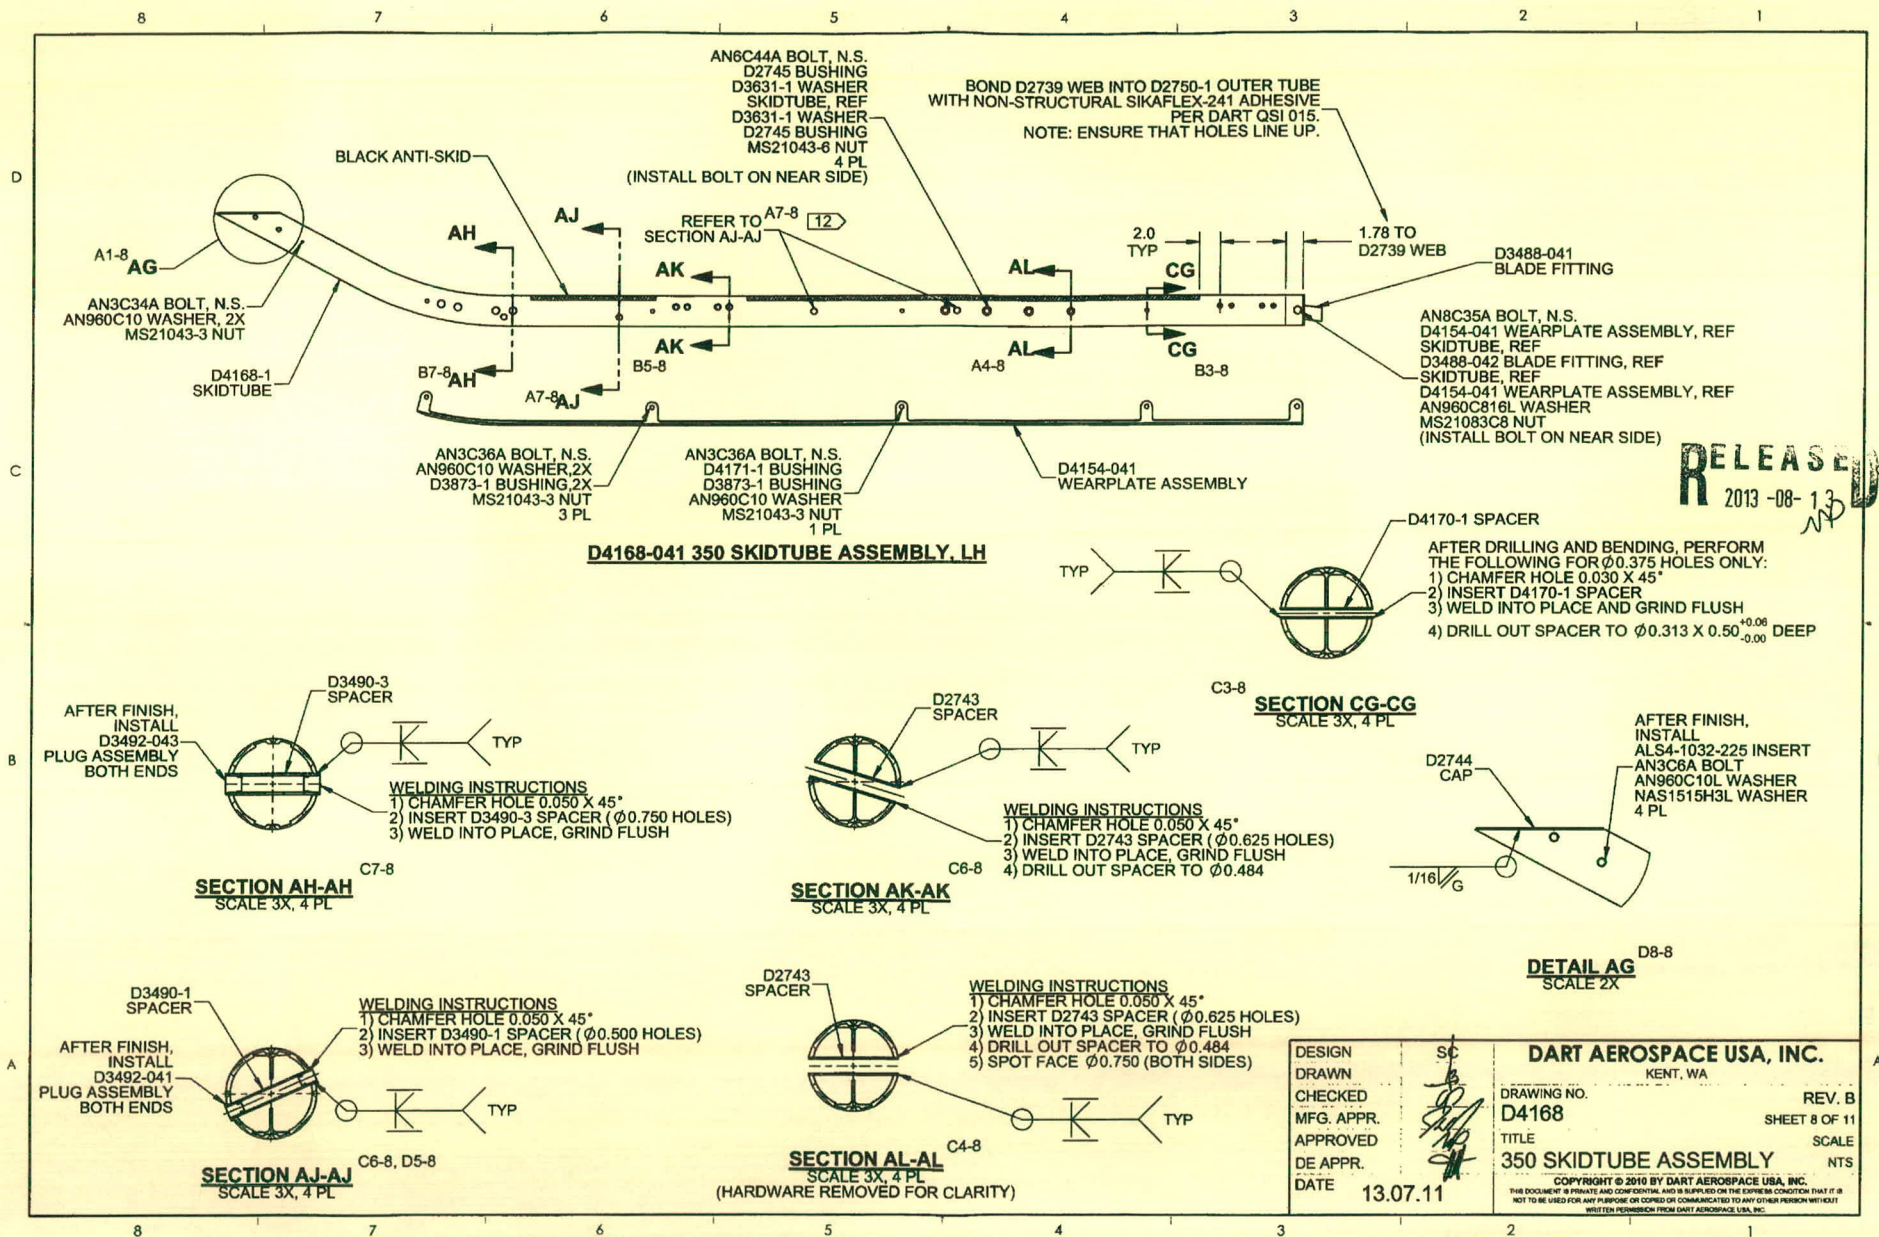


RELEASED
2013-08-13

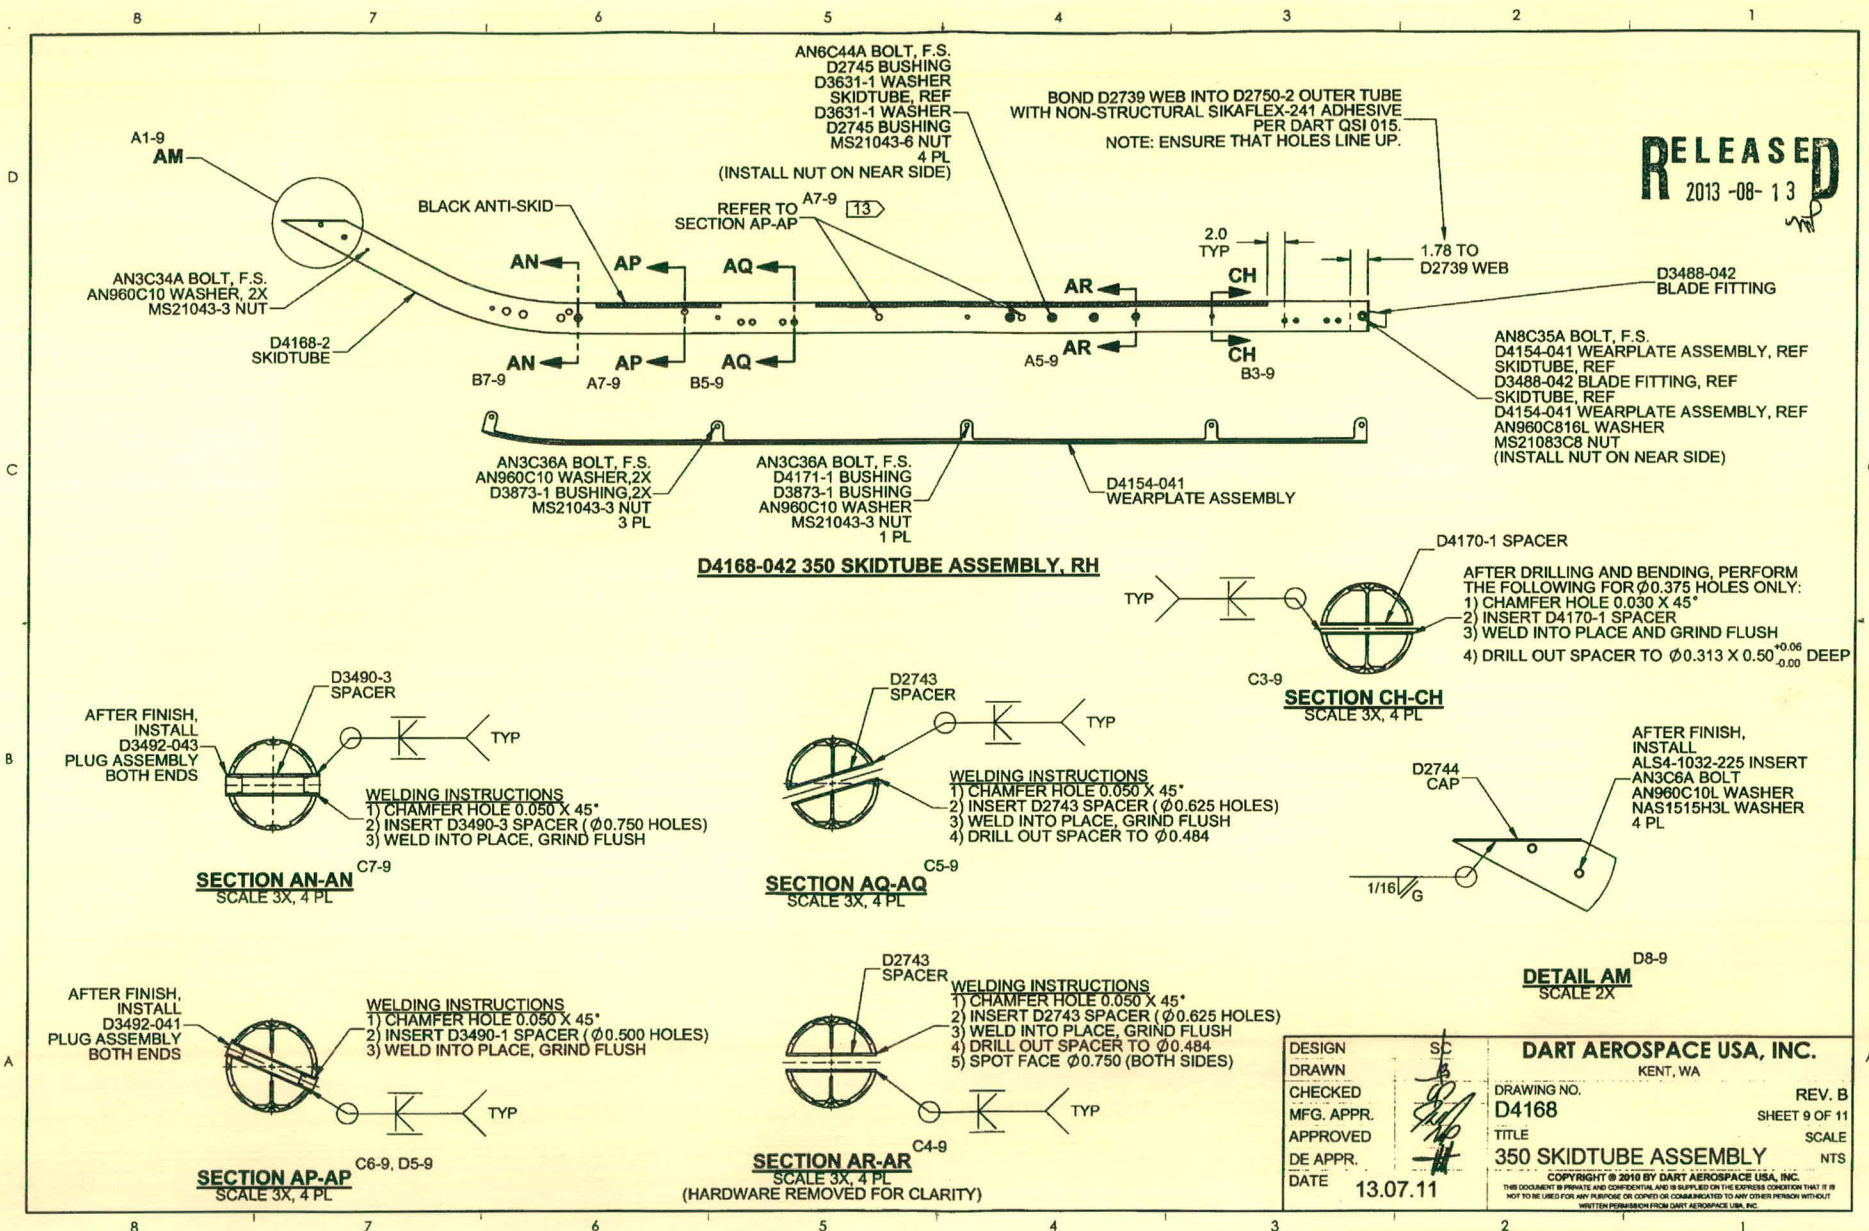

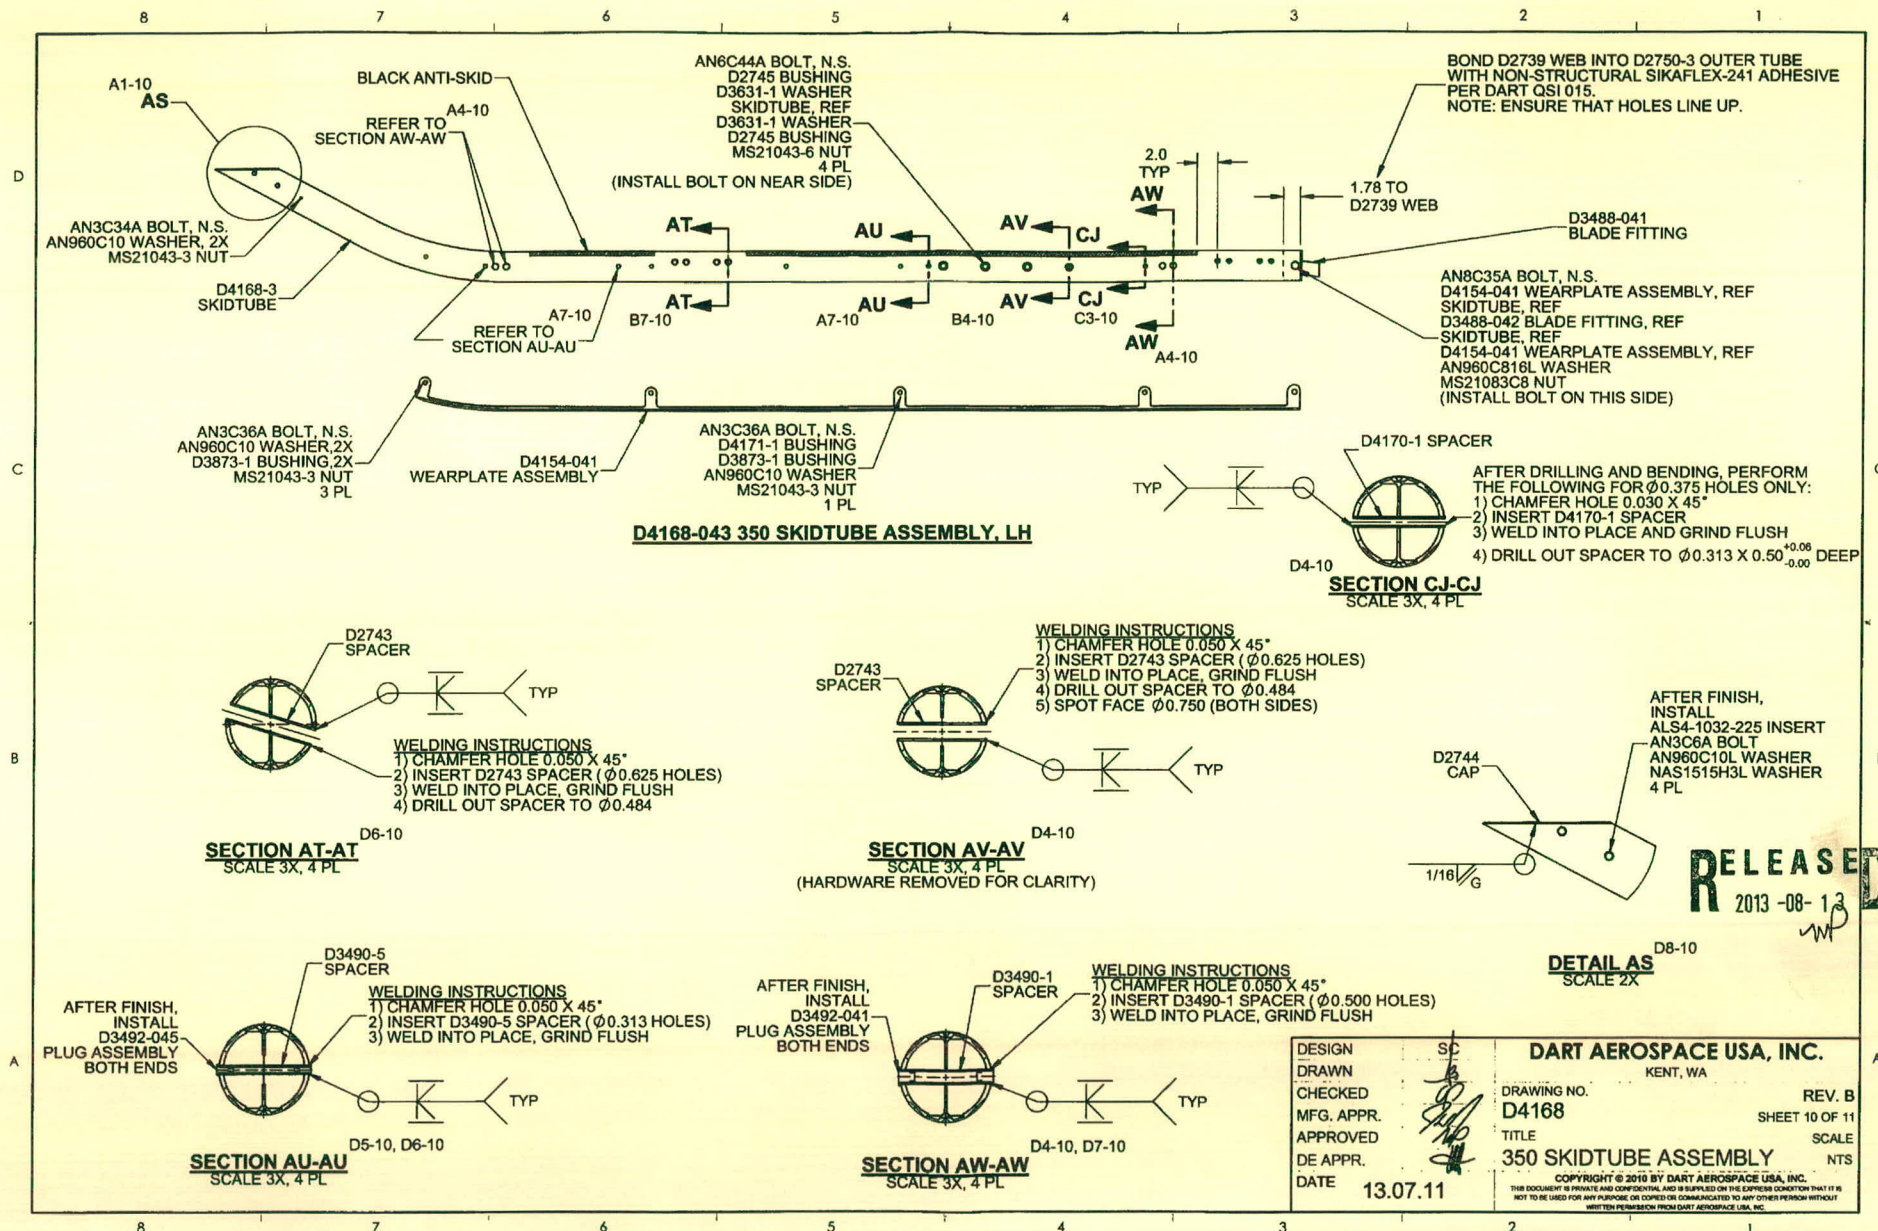


RELEASED
2013-08-13


8 7 6 5 4 3 2 1

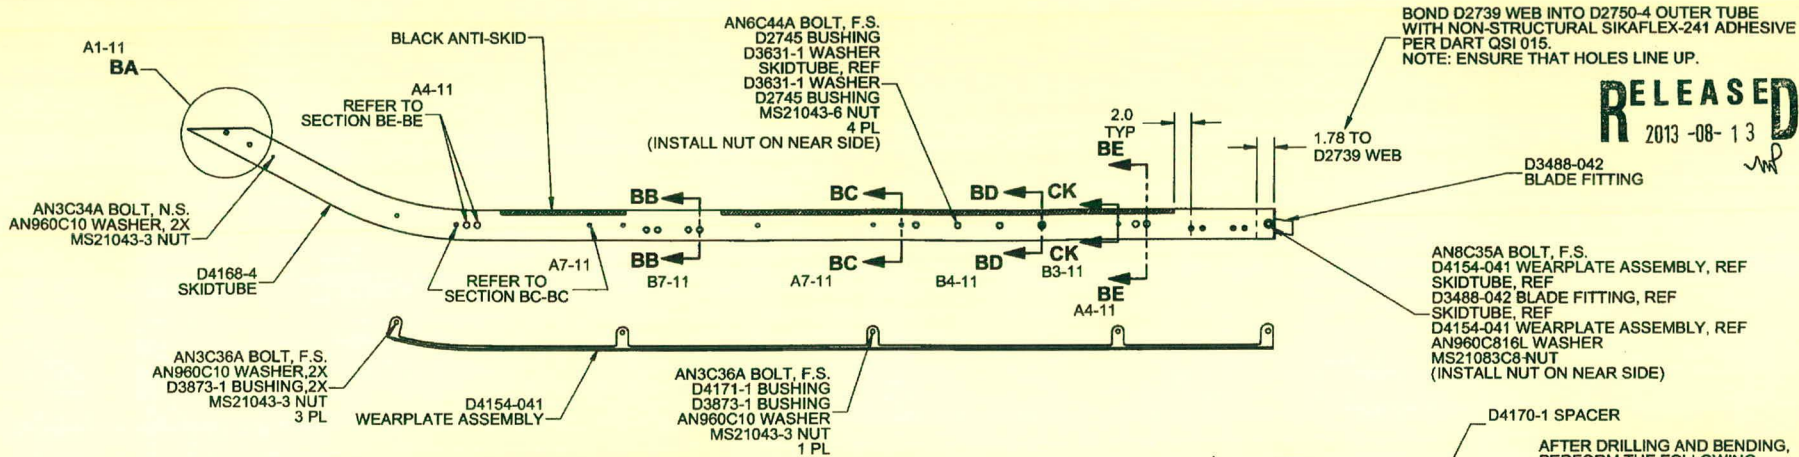


RELEASED
2013-08-13

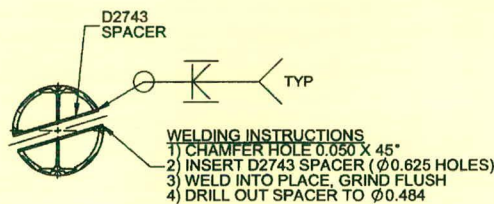


SECTION BB-BB
SCALE 3X, 4 PL



SECTION BD-BD
SCALE 3X, 4 PL
(HARDWARE REMOVED FOR CLARITY)

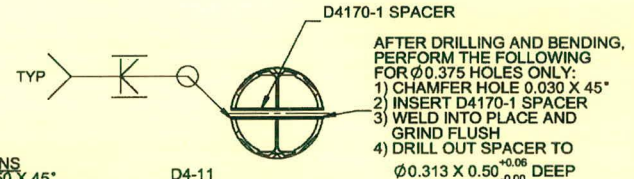


SECTION CK-CK
SCALE 3X, 4 PL

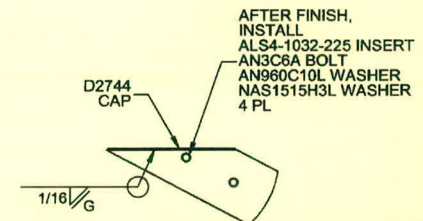

DETAIL BA
SCALE 2X



SECTION BC-BC
SCALE 3X, 4 PL

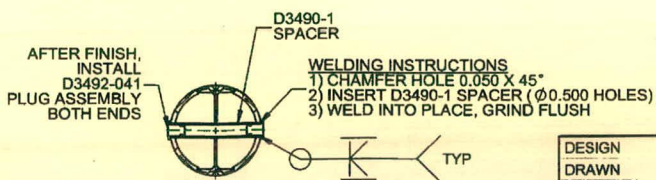

SECTION BE-BE
SCALE 3X, 4 PL

DESIGN		SC		DART AEROSPACE USA, INC.	
DRAWN		KENT, WA		REV. B	
CHECKED		DRAWING NO. D4168		SHEET 11 OF 11	
MFG. APPR.		TITLE		SCALE	
APPROVED		350 SKIDTUBE ASSEMBLY		NTS	
DE APPR.		DATE 13.07.11		COPYRIGHT © 2010 BY DART AEROSPACE USA, INC.	
DATE		13.07.11		THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

SPECIFICATION CONTROL DRAWING

D2600-X-XXX EXTRUSION

NOTES:

1) MATERIAL: 6061-T6 ALUMINUM PER QQ-A-200/8 OR AMS-QQ-A-200/8 OR ASTM B221


MINIMUM TENSILE YIELD STRENGTH = 35 KSI
MINIMUM ULTIMATE TENSILE STRENGTH = 40 KSI
MINIMUM ELONGATION = 8%

A SAMPLE FROM EACH BATCH WILL BE PULL TESTED TO ASTM STANDARD B221 BY AN APPROVED TESTING FACILITY TO ENSURE THAT THE BATCH MEETS THE ABOVE MINIMUM MECHANICAL PROPERTIES


- 2) FINISH: N/A
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N & B/N PER DART QSI 044 6.1 (FINE POINT PERMANENT INK MARKER)
- 7) WEIGHT: D2600-1 = 0.078 lb/in, D2600-3 = 0.130 lb/in, D2600-5 = 0.045 lb/in, D2600-7 = 0.091 lb/in
- 8) NO TOOLING MARKS
- 9) FOR D2600-1, PART NUMBER IS D2600-1-XXX WHERE XXX IS CUT LENGTH (EX. D2600-1-160 IS 160" LONG).
D2600-1 EXTRUSION MANUFACTURED FROM:
 - CARADON INDALEX DIE # MH-18870
 - SIGNATURE ALUMINUM (BON-L) DIE # 897121
- 10) FOR D2600-3, PART NUMBER IS D2600-3-XXX WHERE XXX IS CUT LENGTH (EX. D2600-3-120 IS 120" LONG).
D2600-3 EXTRUSION MANUFACTURED FROM:
 - CARADON INDALEX DIE # MH-18859
 - SIGNATURE ALUMINUM (BON-L) DIE # 897122
- 11) FOR D2600-5, PART NUMBER IS D2600-5-XXX WHERE XXX IS CUT LENGTH (EX. D2600-5-108 IS 108" LONG).
D2600-5 EXTRUSION MANUFACTURED FROM:
 - CARADON INDALEX DIE # MS-18871
- 12) FOR D2600-7, PART NUMBER IS D2600-7-XXX WHERE XXX IS CUT LENGTH (EX. D2600-7-125 IS 125" LONG).
D2600-7 EXTRUSION MANUFACTURED FROM:
 - CARADON INDALEX DIE # MS-18872

RELEASED
2012-01-11

E	REFORMAT DWG; ALL DIMS & TOL. UPDATE TO MATCH MFG DIE DWGS; ADD ASTM B221 SPEC (D8-1)	CP	11.10.18
D	INCREASE MIN. UTS TO 40 KSI	DS	98.08.20
C	ADD D2600-3, UPDATE D2600-1 WIDTH, ADD DIE NO.	DS	98.04.16
B	CHANGE MATERIAL SPEC.	DS	97.09.09
A	NEW ISSUE	DS	97.01.21
REV.	DESCRIPTION	BY	DATE
DESIGN	<i>[Signature]</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	<i>[Signature]</i>		
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>[Signature]</i>	D2600	SHEET 1 OF 3
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	EXTRUSION	NTS
DATE	11.10.18	COPYRIGHT © 1997 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

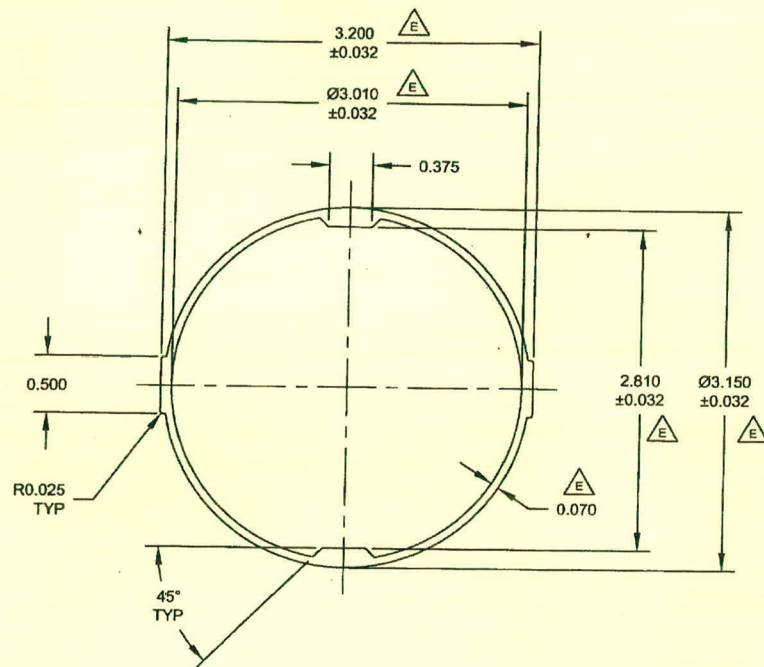


D2600-1 EXTRUSION

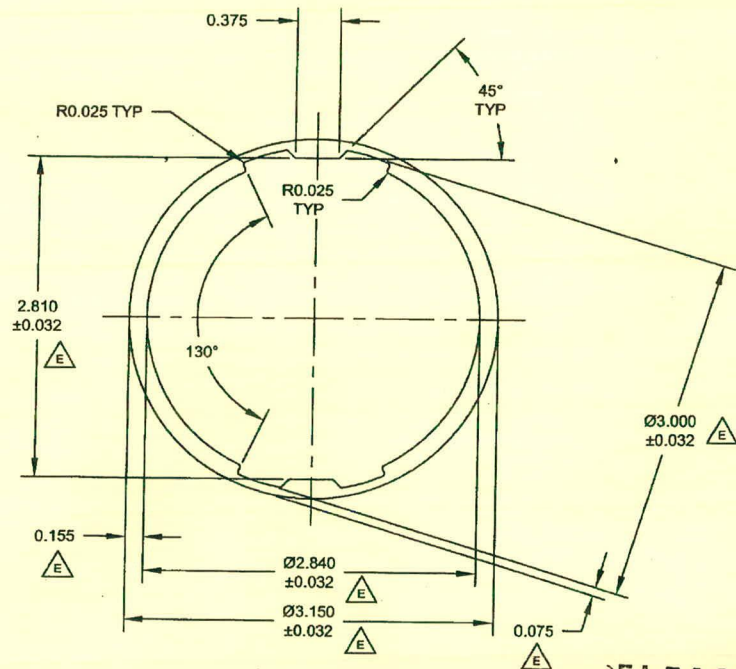

D2600-3 EXTRUSION

RELEASED
2012-01-11

DESIGN	1	DART AEROSPACE LTD	
DRAWN	1	HAWKESBURY, ONTARIO, CANADA	
CHECKED	ASS	DRAWING NO.	REV. E
MFG. APPR.	E	D2600	SHEET 2 OF 3
APPROVED	WMD	TITLE	SCALE
DE APPR.	WMD	EXTRUSION	NTS
DATE	11.10.18	COPYRIGHT © 1997 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			



RELEASED
JUN 2012 -01-11

DESIGN	<i>4</i>	DART AEROSPACE LTD	
DRAWN	<i>Q</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>AS</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>EL</i>	D2600	SHEET 3 OF 3
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	EXTRUSION	NTS
DATE	11.10.18	COPYRIGHT © 1997 BY DART AEROSPACE LTD. THIS DOCUMENT IS PRIVATE CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER **PO041427**

Supplier: ATE003-VC
Atelier Debosselage
358 Principale
Calumet
QC
J0V 1B0 Canada
Phone: 819 242 5633

PO No: PO041427

PO Date: 10/23/18

Due Date: 10/26/18

**Purchase Order
Revision:**

Revision Date:

Ship-To Contact: Phone:

Ship To: 1270 Aberdeen Street
Hawkesbury
ON
K6A 1K7 Canada
Phone: 613-632-5200

Via: Ground

Pymt Terms: Net 30

Freight Terms:

Special Comments:

Items

Line Item	Job	Part	Description	Status	Account	Due Date	Order Quantity	Received Quantity	Balance	Unit Price (CAD)	Extended Price
1	182676	D350-636-015	1- PRIME AS PER DWG AND QSI 005 4.2.1.3.3 PRIMER PRC DESOTO 515X349 BATCH: _____ 2- PAINT WHITE AS PER DWG AND QSI 005 4.2 PAINT BATCH: _____	Firmed	-	10/26/18	1 pcs	0 pcs	1 pcs	\$225.00/pcs	\$225.00
2	178945	D350-636-012	1- PRIME AS PER DWG AND QSI 005 4.2 PRIMER PRC DESOTO 515X349 BATCH: _____ 2- PAINT WHITE AS PER DWG AND QSI 005 4.2 PAINT BATCH: _____	Firmed	-	10/26/18	1 pcs	0 pcs	1 pcs	\$225.00/pcs	\$225.00
3	182677	D350-636-016	1- PRIME AS PER DWG AND QSI 005 4.2 PRIMER PRC DESOTO 515X349 BATCH: _____ 2- PAINT WHITE AS PER DWG AND QSI 005 4.2 PAINT BATCH: _____	Firmed	-	10/26/18	1 pcs	0 pcs	1 pcs	\$225.00/pcs	\$225.00
4	180932	D206-642-541	Make sure Nut Plate Thread is protected using paint screw. 1- PRIME AS PER DWG AND QSI 005 4.2 PRIMER PRC DESOTO 515X349 BATCH: _____ 2- PAINT WHITE AS PER DWG AND QSI 005 4.2 PAINT BATCH: _____	Firmed	-	10/26/18	1 pcs	0 pcs	1 pcs	\$225.00/pcs	\$225.00



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER **PO041427**

Items											
Line Item	Job	Part	Description	Status	Account	Due Date	Order Quantity	Received Quantity	Balance	Unit Price (CAD)	Extended Price
	180935		<i>1x</i> OCT 24 2018	Firmed	-	10/26/18	1 pcs	0 pcs	1 pcs	\$225.00/pcs	\$225.00
	167711		<i>1x</i> OCT 25 2018	Firmed	-	10/26/18	1 pcs	0 pcs	1 pcs	\$225.00/pcs	\$225.00
Sub Total:							3	0	3		\$675.00

Grand Total: \$1,350.00

Order Notes

Procurement Quality Clauses
A005 right of entry
A012 chemical and physical test report
A016 personnel qualification
A017 raw material identification (as applicable)

A022 Apical Processing
A024 process certifications
A026 certification of material conformance

A041 quality management system
A042 dart notification by supplier
A043 retention of quality documents

A048 counterfeit parts avoidance, detection, mitigation and disposition program

A049 supplier awareness

Terms & Condition of Purchasing(Suppliers) and Procurement Quality Clauses are an integral part of our AS9100 requirements. To learn in detail, please visit www.dartaerospace.com for further explanation.

Plex 10/23/18 3:28 PM dart.tsimiklis.chrisoula

Kim Johnston

From: Sonia Quirion
Sent: Thursday, November 01, 2018 6:17 AM
To: Kim Johnston; Michelle GagnonDonovan
Subject: L/B

d350-636-016 S108258 2L/B WHITE I RED
d350-636-015 S109868
d350-636-012 S107590

Change Record

PAGE 1 OF 1

Part Number: D350-636-015/-016

Description: SKIDTUBE STD LH/RH w/ TRAINING WEARPLATE

[illegible]

